



Applies To: **2000-03 S2000 – ALL**

**February 25, 2003**

## Convertible Top Cover Snap Is Broken

### SYMPTOM

One or more snaps that secure the convertible top cover are broken.

### PROBABLE CAUSE

Incorrect use of the snaps; forcing the snap onto the pin without pulling the button back.

### CORRECTIVE ACTION

Replace the snap(s).

### PARTS INFORMATION

Short Snap:

P/N 90316-S2A-000, H/C 6245336

Long Snap:

P/N 90318-S2A-000, H/C 6385769

### REQUIRED MATERIALS

Hondalock 2 (one bottle will do 100 repairs):

P/N 08713-0002, H/C 2963833

### WARRANTY CLAIM INFORMATION

**In warranty:** The normal warranty applies.

Operation Number: 814136

Flat Rate Time: 0.2 hour

Failed Part: P/N 90316-S2A-000  
H/C 6245336

Defect Code: 018

Contention Code: B99


Skill Level: Repair Technician

**Out of warranty:** Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.



### REPAIR PROCEDURE

1. Inspect the inside of each snap to determine which ones need replacing.


**'00-01 Models:**

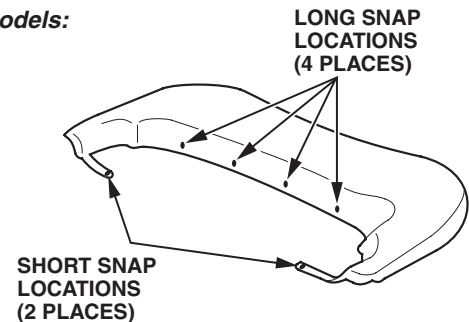

**'02-03 Models:**

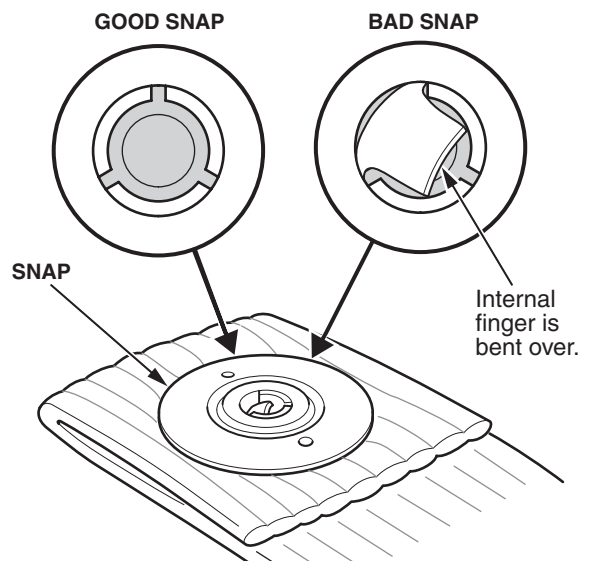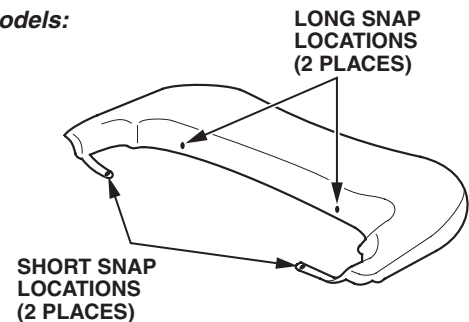

2. Use snap ring pliers to remove the damaged snap(s) from the convertible top cover.

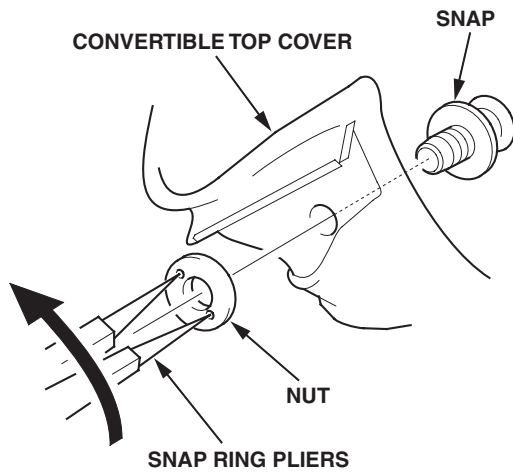

3. Apply Hondalock 2 to the threads, then install the new snap(s).
4. Inform the customer of the proper way to use the snaps.

**NOTE:** When installing or removing the convertible top cover, the button on the snap must be pulled to install the snap onto the pin or to release the snap from the pin.

